
HIOKI

POWER QUALITY ANALYZER PQ3100

NEW



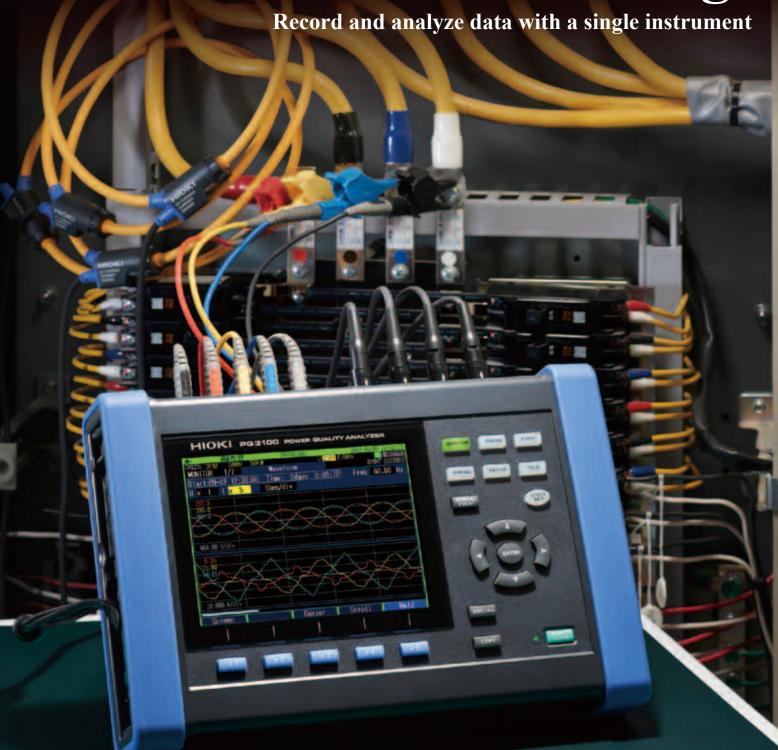

Reliable power supply maintenance, management, troubleshooting, and analysis

The power grid is the single most important piece of infrastructure in our society, and regular maintenance and management are essential in order to prevent problems. When power supply issues are caused by factors such as equipment malfunctions or rapid surges in power demand, personnel are called upon to analyze the underlying causes quickly and precisely. The PQ3100 aids in reliable power analysis by delivering analytical capabilities that reliably captures the full range of power anomalies along with exceptional ease of use that facilitates each step of instrument operation, from connecting it to the circuit to recording data.



Recording power quality data for the grid


The PQ3100 records data including voltage, current, power, harmonics, and flicker* simultaneously along a single time axis, and the included PQ ONE application software makes it easy to create reports.



Analyzing device power supply issues

When you need to resolve issues with a device that unexpectedly malfunctions or suddenly stops, the PQ3100 captures all power anomalies, including instantaneous outages, voltage drops, and frequency fluctuations, while simultaneously recording trend data.



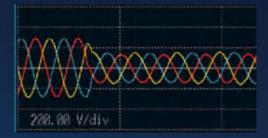

Measuring AC/DC power

Used in combination with an AC/DC auto-zero current sensor, the PQ3100 can accurately measure DC currents over extended periods of time. Since the instrument supplies power to connected sensors, there's no need to use an additional power supply for sensors.








**

Simultaneously measure all parameters at once


Measuring all parameters at the same time

The PQ3100 makes it easy to verify current conditions by displaying all measurement parameters simply by toggling the screens.

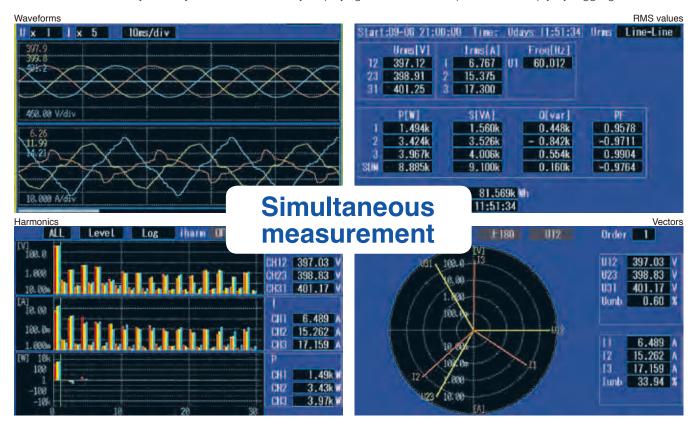

Simultaneously recording trend graphs and event waveforms

The PQ3100 records trend data for all parameters at once. When the PQA detects a power anomaly, the event is immediately recorded. Since maximum, minimum, and average values are recorded during each interval, you'll never miss peak values.

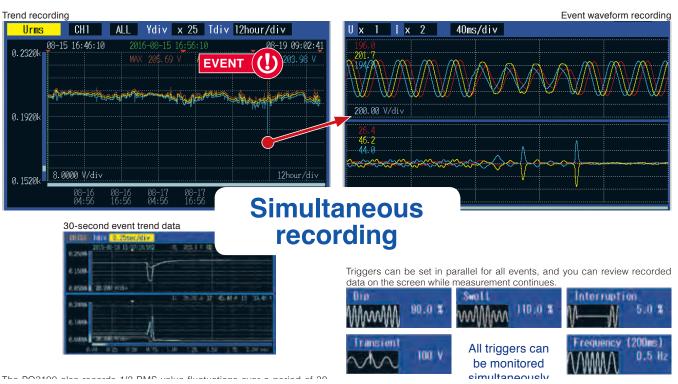

Easy wiring and configuration. Reliable measurement.

Quick Set: Easy-to-understand on-screen quide for measurement procedures

Simply launch Quick Set to navigate - from connecting and configuring the instrument to starting recording.

Setup Flow (example: 3P4W)

Choose the wiring type and connect cables to the instrument.



STEP 2 Connect the voltage cables and current sensors to the measurement target.



The instrument automatically performs a wiring check and displays the results.

On-screen help notification



Example on-screen help:

If the clamp-on sensor is oriented incorrectly, the instrument won't be able to measure power and power factor accurately



Set the parameters to record and the recording interval.

QUICK

STEP 5

Start recording.

With Easy Setup, you can choose the parameters to record with one touch.

Capture power supply problems such as equipment Voltage events anomalies. Voltage-related events will be set.

Measure inrush current. Threshold is set at 200% of the


Inrush current current RMS. Input voltage into CH1.

Trend record only Record trend data only. All event items are set to OFF.

Measure according to the EN50160 standard. Recording interval is set to 10 minutes.

Record 11 seconds of data before and after events

The PQ3100 can record waveforms for up to 1 second before and 10 seconds after an anomaly occurs. This capability is helpful when you need to analyze data bracketing an anomaly or when you need to verify normal return for a solar power conditioner.



Superior level of safety

EN50160

The PQ3100 supports CAT III (1000 V) and CAT IV (600 V) measurements.

High-precision measurement

Voltage RMS value accuracy: ±0.2% of nominal voltage Swell, dip, outage: ±0.3% of nominal voltage The PQ3100 complies with the IEC 61000-4-30 Class S standard.

Find Quality Products Online at:

www.GlobalTestSupply.com

sales@GlobalTestSupply.com

5 Drive sensors without an external power supply



Since the PQA supplies power, there's no need to use a separate AC adapter for AC/DC sensors or flexible sensors.

Measure DC power over extended periods of time



Used in combination with an auto-zero current sensor, the PQ3100 can measure DC power over extended periods of time without the need to worry about zeropoint drift.

9 Long-term recording of data on an SD memory card

Choose optional cards with 2 GB or 8 GB of capacity.

Recording times when using a 2 GB SD memory card

Recording interval (example values)	Without harmonics	With harmonics	Event recording
200 ms	25 h 40 m	n/a	n/a
1 sec	5 d 7 h	7 h	Yes
2 sec	10 d 14 h	14 h	Yes
10 sec	53 d 12 h	2 d 21 h	Yes
1 min	321 d	17 d	Yes
10 min	1 year	178 d	Yes
30 min	1 year	1 year	Yes

6 Easily install in confined spaces



Flexible current sensors are convenient when making measurements in a confined space and when measuring a two- or three-line power circuit.

Extensive range coverage for use in an array of applications



For example, the CT7136 lets you choose from three measurement ranges (5 A, 50 A, or 500 A), allowing it to be used in a broad range of applications, from the secondary side of a CT to wires carrying large currents.

10 Up to 8 hours of battery operation

The PQ3100's energy-saving design means its battery lasts a long time, allowing you to continue measuring following a power outage or make measurements after taking the instrument to sites in the field.

11 Remote control via Ethernet

Configure settings or monitor contents from a remote location. You can also download data using the PQ3100's FTP function (available in a future firmware update).

Comparison of PQ3100 and PW3198 specifications

	Model	PQ3100	PW3198	
		***************************************	The second secon	
AC/DC		Yes	Yes	
Fundamental f	requency	DC/ 50 Hz/ 60 Hz	DC/ 50 Hz/ 60 Hz/ 400 Hz	
Measurement	lines	Single-phase 2-wire, single-phase 3-wire, three-	ohase 3-wire, three-phase 4-wire + Ch. 4	
	Number of channels	4 (U4: Not isolated)	4 (U4: Isolated from U1 to 3)	
Voltage input	Maximum terminal-to- ground rated voltage	1000 V (measurement category III) 600 V (measurement category IV)	600 V (measurement category IV)	
Current innut	Number of channels	4	4	
Current input	Power supply for sensors		n/a	
	Voltage	1/2 RMS value (half-wave offset wave calculation) Unbalance factor (negative-phase, zero-phase	e), frequency (1 wave/ 200 ms/ 10 sec.)	
		Crest factor	n/a	
	Current	Inrush current (half-wave), RMS value, waveform peak, Current DC		
		1/2 RMS value (half-wave offset wave calculation), crest factor n/a Active power, Reactive power, Apparent power, Power factor, Displacement power factor, Active energy, Reactive energy		
Measurement	Power			
parameters		Apparent energy, Electrical charges Support for flicker measurement planned	n/a Pst, Plt, ΔV10	
	Flicker	with a future firmware update.	ראו, הוו, מעוט (simultaneous measurement of 3 channels)	
	Harmonics	Oth order (DC) to 50th order, Voltage/Current/ Voltage/Current phase difference, Total harm	Power, Phase angle (voltage/ current),	
	Inter-harmonics	0.5th order to 49.5th order, voltage/ current		
	High-order harmonics	n/a	2 kHz to 80 kHz	
Time-series	Recording period	Max. 1 year	Max. 1 year (55 weeks with repeat function on)	
measurement	Recording interval time	200 ms/600 ms/150 cycles (with 50 Hz input)/1/2/5/10/15/30 sec. to 2 h	150 cycles (with 50 Hz input), 1/3/15/30 sec. to 2 h	
	Maximum number of recordable events	9999 events × 365 days of repeat operation	1000 events × 55 repeats	
Event	Event statistical processing	Display of the number of events per day by event type (Support for event statistics planned with a future firmware update.)	n/a	
measurement	Waveform Before even	Max. 1 sec.	n/a	
	acquisition: At event	200 ms	200 ms	
	After event	Max. 10 sec.	Max. 1 sec. (with series of events)	
		Voltage Swell/ Dip/ Interruption/ Frequency		
Event parameters	Measurable event parameters	-	RMS value/ Voltage waveform peak/ Current waveform peak/ Comparison of voltage waveforms/ Harmonics/ Unbalance factor/ Power	

Find Quality Products Online at:

www.GlobalTestSupply.com

sales@GlobalTestSupply.com

IEC 61000-4-30 standard compliance Class S Class A


PQ One: Analyze data and create reports on a PC with a dedicated application

The PQ3100 includes PQ ONE, a power quality analysis application whose latest version can be downloaded free of charge from Hioki's website.



Event statistics

Display statistics on event occurrence by date and time, making it easy to discover anomalies that occur during specific time periods or days of the week.

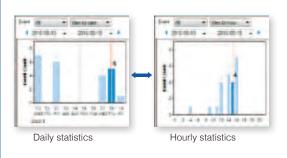

Event list

Display statistics on event occurrence by date and time, making it easy to discover power supply anomalies that occur during certain time periods or days of the week.

Report creation

Automatically create reports simply by choosing measurement parameters. If you output the report in Microsoft Word* format, you can also add comments.



Trend graphs


Display time-series graphs of parameters such as voltage, current, frequency, harmonics, unbalance factor, power, and energy. Configure the display range on screen as desired and create reports by outputting graphs as-is.



Choose measurement parameters, channels, and maximum, minimum, or average values.

Event details

Analyze 200 ms event waveforms, including parameter waveforms, harmonics, vectors, and value displays. You can also display 30 seconds of event trend data and 11 seconds of pre- and post-event waveforms.

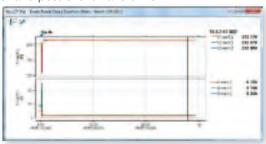

Find Quality Products Online at:

www.GlobalTestSupply.com

sales@GlobalTestSupply.com

Input channels	Voltage: 4 channels, Current: 4 channels	
Input terminal profile	Voltage: Plug-in terminals (safety terminals) Current: Dedicated connector (HIOKI PL14)	
Measurement circuits	Any of the following plus Ch. 4 additional input: Single-phase 2-wire: 1P2W Single-phase 3-wire: 1P3W Single-phase 3-wire/1-voltage measurement: 1P3W1U Three-phase 3-wire/2-power measurement: 3P3W2M Three-phase 3-wire/3-power measurement: 3P3W3M Three-phase 4-wire: 3P4W	
Input methods	Voltage: Isolated input (U1/U2/U3/U4 and N-terminal common differential input, U1/U2/U3/U4 and N not isolated) Current: Isolated input via current sensors	
Input resistance	Voltage inputs: $5~M\Omega$ Current inputs: $200~k\Omega$	
Maximum input voltage	Voltage inputs: 1000 V AC/DC, 2200 Vpeak	
Maximum rated voltage to earth	1000 V AC (CAT III), 600 V AC (CAT IV) Anticipated transient overvoltage: 8000 V	
Measurement method	Digital sampling and zero-cross synchronous computation	
Sampling frequency	200 kHz	
A/D converter resolution	16bit	
Display range	Voltage: 2 V to 1300 V Current: 0.4% to 130% of range Power: 0.0% to 130% of range Measurement parameters other than above: 0% to 130% of range	
Effective measurement range	Voltage: AC: 10 V to 1000 V, peak ±2200 V DC: 5 V to 1000 V Current: 5% to 120% of range, peak ±400% of range Power: 5% to 120% of range (with voltage and current that both fall within effective measurement range)	

, , , ,	
Conditions of accuracy guarantee	Guaranteed accuracy period: 1 year Post-adjustment accuracy guaranteed period: 1 year Guaranteed accuracy temperature and humidity range: 23°C ±5°C, 80% RH or less Warmup time: 30 m or more Power supply frequency range: 50 Hz/60 Hz ±2 Hz Defined for power factor of 1, common-mode voltage of 0 V, and after zero-adjustment. The following additional conditions apply for AC measurement: Input of at least 10 Vrms to reference channel (U1) With measurement frequency set to 50 Hz: 40 Hz to 58 Hz With measurement frequency set to 60 Hz: 51 Hz to 70 Hz
Temperature coefficient	0.1% f.s./°C
Effects of	0.2% f.s. or less (1000 Vrms AC, 50 Hz/60 Hz,

between voltage input and enclosure)

magnetic field of 400 A rms AC/m, 50 Hz/60 Hz)

Measurement item	S

Accuracy specifications

Transient overvoltage,

common-mode voltage

Effects of

RMS voltage refreshed each half-cycle, Voltage waveform peak.

Voltage DC value, Voltage CF value, RMS voltage (phase), RMS voltage (line to line), Swell, Dip, Interruption, RMS current refreshed each half-cycle,

Current waveform peak, Current DC value, Current CF value, RMS current, Inrush current.

Frequency cycle, Frequency (200ms), 10-sec Frequency,

Active power, Active energy, Energy cost, Reactive power, Reactive energy,

Apparent power, Apparent energy,

Power factor / Displacement power factor,

Voltage unbalance factor (negative-phase, zero-phase), Current unbalance factor (negative-phase, zero-phase), Harmonic voltage, Harmonic current, Harmonic power,

Inter-harmonic voltage, Inter-harmonic current,

Harmonic voltage phase angle. Harmonic current phase angle.

Harmonic voltage-current phase angle, Total harmonic voltage distortion factor,

Total harmonic current distortion factor, K Factor

Measurement specifications

Detected from waveform obtained by eliminating the fundamental component (50 Hz/60 Hz) from the sampled waveform.

Measurement range: ±2.200 kVpeak

Measurement bandwidth: 5 kHz (-3dB) to 40 kHz (-3dB) Measurement accuracy: ±5.0% rdg.±1.0% f.s.

Frequency cycle

Calculated as the reciprocal of the accumulated whole-cycle time during one U1 cycle.

RMS voltage/ RMS current refreshed each half-cycle

Calculated as the RMS value of sampling data for 1 waveform overlapped every half-cycle.

Measurement accuracy: Voltage With 10 V to 660 V input: ±0.3% of nominal voltage

Other than above: ±0.2% rdg.±0.1% f.s. Current ±0.2% rdg.±0.1% f.s. + current sensor accuracy

Swell, Dip, Interruption

Detected when the RMS voltage refreshed each half-cycle value exceeds the threshold.

Measurement accuracy:

Same as RMS voltage refreshed each half-cycle Saves RMS voltage and current refreshed each half cycle

for 0.5 s before and 29.5 s after the event IN point.

Inrush current

Calculated as the current RMS value for current waveform data sampled every half-cycle. Maximum current RMS value from above measurement.

Measurement accuracy: ±0.3% rdg.±0.3% f.s. + current sensor accuracy Saves inrush current RMS value data for 0.5 s before and Fluctuation:

29.5 s after the event IN point.

10-sec frequency

Calculated as the reciprocal of the accumulated whole-cycle time during the specified

10 s U1 (reference channel) period.

Measurement accuracy: ±0.010 Hz or less

Frequency (200ms)

Calculated as the reciprocal of the accumulated whole-cycle time within 200 ms relative to U1.

±0.020 Hz or less Measurement accuracy:

Voltage waveform peak/ Current waveform peak

Maximum and minimum sampling points in 200 ms aggregation

Measurement range: Voltage ±2200.0 Vpk

Current Result of adding the crest factor to the current range Voltage During input of 10% to 150% of nominal voltage: Measurement accuracy:

5% of nominal voltage Other than above: 2% f.s Current With at least 50% f.s. input:

5 % rdg. + current sensor accuracy

Other than above:

2% f.s. + current sensor accuracy

RMS voltage, RMS current

Measured during 200 ms aggregation in accordance with IEC 61000-4-30.

Voltage With 10 V to 660 V input: ±0.2% of nominal voltage

Other than above: ±0.1%rdg.±0.1%f.s.

Current ±0.1% rdg.±0.1% f.s. + current sensor accuracy

Voltage DC value, Current DC value

Average value during 200 ms aggregation

Voltage ±0.3% rdg.±0.1% f.s. Measurement accuracy:

Current ±0.5% rdg.±0.5% f.s. + current sensor accuracy

Voltage CF value, Current CF value

Calculated from the voltage RMS value and the voltage waveform peak value

Measurement range: Voltage 224.001 Current 408.00

Measurement accuracy: No defined accuracy

Active power/ Apparent power/ Reactive power

Measured every 200 ms. Active power:

Apparent power: RMS value calculation: Calculated from the voltage RMS

value and current RMS value.

Fundamental wave calculation: Calculated from the fundamental wave active power and fundamental wave

Reactive power: RMS value calculation: Calculated from the apparent power

S and active power P.

Fundamental wave calculation: Calculated from the

fundamental wave voltage and current.

Measurement accuracy

DC: ±0.5% rdg.±0.5% f.s. + current sensor accuracy

AC: ±0.2% rdg.±0.1% f.s. + current sensor accuracy Power factor effects: 1.0% rdg. or less (40 Hz to 70 Hz

with a power factor of 0.5)

Apparent power ±1 dgt. for calculations derived from the various measurement values Reactive power During RMS value calculation: ±1 dgt. for calculations

derived from the various measurement values

During fundamental wave calculation: For fundamental wave frequency of 45 Hz to 66 Hz

Active energy, Reactive energy, Apparent energy

Measures energy from start of recording.

Integrated separately by consumption and regeneration from active power Active energy: Integrated separately by lag and lead from reactive power.

Reactive energy:

Integrated from apparent power.

Measurement accuracy:

Active energy: Active power measurement accuracy ±10 dgt. Reactive energy: Reactive power measurement accuracy ±10 dat. Apparent energy: Apparent power measurement accuracy ±10 dgt. Cumulative time accuracy: ±10 ppm

Calculated by multiplying the active energy (consumption) WP+ by the electricity unit

Measurement accuracy: ±1 dgt. for calculations derived from the various measurement values

Power factor, Displacement power factor

Calculated from apparent power S and active power P Displacement power factor: Calculated from fundamental wave active power and reactive power.

Harmonic voltage, Harmonic current

Uses IEC61000-4-7 Ed2.1:2009. From 1 to 50th order

Measurement range:

Harmonic voltage RMS: 600.00 V, Content percentage: 100.00 %

Harmonic current Based on current sensor in use. Content percentage: 500.00 %

Measurement accuracy

Harmonic voltage

Order 0 Same as voltage DC value Order 1 Same as voltage RMS value

Order 2 to 50th 1% of nominal input voltage or greater: ±10.0% rdg.

Less than 1% of nominal input voltage: ±0.05% of nominal input voltage

Harmonic current

Order 0 Same as current DC value

Order 1 to 20th ±0.5% rdg.±0.2% f.s. + current sensor accuracy Order 21 to 30th ±1.0% rdg.±0.3% f.s. + current sensor accuracy Order 31 to 40th ±2.0% rdg.±0.3% f.s. + current sensor accuracy Order 41 to 50th ±3.0% rdg.±0.3% f.s. + current sensor accuracy

Harmonic power

Indicates the harmonic power for each channel and the sum value for multiple channels

Measurement accuracy

Order 0 ±0.5% rdg.±0.5% f.s. + current sensor accuracy Order 1 to 20th ±0.5% rdg.±0.2% f.s. + current sensor accuracy ±1.0% rdg.±0.3% f.s. + current sensor accuracy Order 21 to 30th Order 31 to 40th ±2.0% rdg.±0.3% f.s. + current sensor accuracy ±3.0% rdg.±0.3% f.s. + current sensor accuracy

Inter-harmonic voltage, Inter-harmonic current

After harmonic analysis, harmonic voltage and current are summed and displayed as inter-harmonic contents with the harmonic contents according to harmonic order From 0.5 to 49.5th order

Measurement accuracy:

Inter-harmonic voltage (harmonic input defined for a nominal input voltage of 100 V to 440 V)

At least 1% of harmonic input nominal voltage: ±10.0% rdg.

<1% of harmonic input nominal voltage: ±0.05% of nominal voltage Inter-harmonic current

No defined accuracy

Harmonic voltage phase angle, Harmonic current phase angle

In accordance with IEC61000-4-7 Ed2.1:2009

Measurement range: 0.00° to ±180.00°

Harmonic voltage-current phase angle

In accordance with IEC61000-4-7 Ed2.1:2009

Measurement range: 0.00° to ±180.00°

Measurement accuracy: Order 1 to 3rd: ±2°

Order 4 to 50th: $\pm (0.05^{\circ} \times k+2^{\circ})$ (k: Harmonic order)

However, add current sensor accuracy.

Defined when the harmonic voltage for each order is 1% of the nominal voltage and the current level is 1% f.s. or greater

Total harmonic voltage distortion factor, Total harmonic current distortion factor

In accordance with IEC61000-4-7 Ed2.1:2009

THD-F: Total harmonic distortion factor for the fundamental wave

THD-R: Total harmonic distortion factor for the total harmonic including the

fundamental wave

Measurement range: 0.00 to 100.00% (Voltage), 0.00 to 500.00% (Current)

Voltage unbalance factor (negative-phase, zero-phase)

Calculated using various components of the three-phase fundamental wave for threephase 3-wire (3P3W2M, 3P3W3M) and three-phase 4-wire connections

Current unbalance factor (negative-phase, zero-phase)

Calculated using various components of the three-phase fundamental wave for threephase 3-wire (3P3W2M, 3P3W3M) and three-phase 4-wire connections

Measurement range: Component is A and unbalance factor is 0.00% to 100.00%

K Factor (multiplication factor)

Calculated using the harmonic RMS current of the 2nd to 50th orders

Measurement range: 0.00 to 500.00

RMS value-frequency characteristics

Frequency	Voltage	Current	Power
40 Hz to 70 Hz	Defined for RMS voltage	Defined for RMS current	Defined for Active power
70 Hz to 1 kHz	±3% rdg. ±0.2% f.s.	±3% rdg. ±0.2% f.s.	±3% rdg. ±0.2% f.s.
1 kHz to 10 kHz	±10% rdg. ±0.2% f.s.	±10% rdg. ±0.2% f.s.	±10% rdg. ±0.2% f.s.
40 kHz	-3 dB	-3 dB	

Measurement setting specifications	
Wiring	Displays wiring diagram and measured values for:
	Ch. 1/2/3: 1P2W, 1P3W, 1P3W1U, 3P3W2M, 3P3W3M, or 3P4W
	Ch. 4: On or off
Voltage range	1000.0 V
Current sensors and	CT7126: 50 A / 5 A / 500 mA
current ranges	CT7131: 100 A / 50 A / 5 A
	CT7136: 500 A / 50 A / 5 A
(Accuracy guaranteed	CT7116: 5 A / 500 mA / 50 mA
up to 120% of range)	CT7731: 100 A / 10 A
	CT7736: 500 A / 50 A
	CT7742: 2000 A / 1000 A / 500 A
	CT7044/CT7045/CT7046: 5000 A / 500 A / 50 A
Power range	
/Datamaia adautamatia	ally to a seed any assume at many and the same A

(Determined automatically based on current range in use.)

Wiring Current range	1P2W	1P3W 1P3W1U 3P3W2M 3P3W3M	3P4W
500.00 mA	500.00 W	1.0000 kW	1.5000 kW
5.0000 A	5.0000 kW	10.000 kW	15.000 kW
50.000 A	50.000 kW	100.00 kW	150.00 kW
500.00 A	500.00 kW	1.0000 MW	1.5000 MW
5000.0 A	5.0000 MW	10.000 MW	15.000 MW
10.000 A	10.000 kW	20.000 kW	30.000 kW
100.00 A	100.00 kW	200.00 kW	300.00 kW
1000.0 A	1.0000 MW	2.0000 MW	3.0000 MW
2000.0 A	2.0000 MW	4.0000 MW	6.0000 MW

CT ratio	0.01 to 9999.99	
VT ratio	0.01 to 9999.99	
Declared input voltage	100/ 101/ 110/ 115/ 120/ 127/ 200/ 202/ 208/ 220/ 230/ 240/ 277/	
	347/ 380/ 400/ 415/ 440/ 480/ 600/	
	User-defined (50 V to 800 V in increments of 1 V)	
Frequency	50 Hz/ 60 Hz	
Sensor recognition	Automatic recognition of current sensors	
Calculation method	Urms: Phase voltage or line voltage	
selection	PF/Q/S: RMS value calculation or fundamental wave calculation	
	THD: THD-F or THD-R	
	<u> </u>	
	*Phase voltage/line voltage setting changes do not apply to	
	RMS voltage refreshed each half-cycle values or transient	
	measured values on the MONITOR screen.	
Energy cost	Unit cost: 0.00000 to 99999.9 (per kWh)	
	Currency unit: 3 alphanumeric characters	

Recording settir	ıgs
Storage location	SD memory card
Display of remaining	Calculates and displays remaining time based on the available
storage space (in time)	space left on the SD memory card and in internal memory,
	the recording interval, and the recording parameters. This
	information is also updated during trend measurement.
Recording interval	200 or 600 ms; 1, 2, 5, 10, 15, or 30 s; 1, 2, 5, 10, 15, or 30 m;
	1 or 2 h; 150 or 180 cycles
	*The following functionality is not available during 200/600 ms
	operation:
	Saving of harmonic data (except total harmonic distortion and K factor)
	Event recording
	COPY key operation during recording
Recording parameters	
	Records maximum, minimum, and average values in binary format.
Saving of screenshots	Off or on
	Saves the displayed screen at the recording interval as a BMP file.
	Minimum interval: 5 m
Methods for	Precise time, manual, time specification, or repeated
starting recording	
Methods for	Manual, time specification, timer, or repeated
stopping recording	Maximum recording/measurement time: 1 year
Recording time period	Allows user to set the time period for which to record data
	during repeated recording.
File/folder names	Automatic or user-specified (using 5 single-byte characters)

Event settings	
Event hysteresis	0% to 10% (for all parameters except frequency) Hysteresis for frequency is fixed at 0.1 Hz or otherwise set as a percentage of the threshold value.
Timer event count	Off; 1, 2, 5, 10, 15, or 30 m; 1 or 2 h
	Generates events at the selected interval.
Event waveform	Instantaneous waveform for approx. 200 ms aggregation (12.5 kS/s)
Pre-event waveform	Off (0 s), 200 ms, 1 s
	Allows user to set the recording time for the instantaneous
	waveform before event occurrence.
Post-event waveform	Off (0 s), 200 ms, 400 ms, 1 s, 5 s, 10 s
	Allows user to set the recording time for the instantaneous
	waveform after the event.

Event specifications

Event detection method

Events can be detected at a recording interval of 1 s or greater

See the measurement specifications for a description of detection methods for each event type's measured values.

External events: Events are detected by detecting signal input to the EVENT IN terminal.

Manual events: Events are detected based on MANUAL EVENT key presses

Synchronized saving of events

Event waveform:

The instantaneous waveform when the event occurs is recorded for 200 ms. Pre-event waveform:

The instantaneous waveform before the event occurs is recorded for up to 1 s. Post-event waveform:

The instantaneous waveform after the event is recorded for up to 10 s.

Fluctuation data:

RMS value fluctuation data is recorded every half-cycle for the equivalent of 0.5 s before the event and 29.5 s after the event.

System settings	
Beep tone	On or off
LCD backlight	Auto-off (2 m) or on
Display languages	Japanese, English, Chinese (traditional or simplified), Korean,
	German, French, Italian, Spanish, Turkish
Phase naming	R/S/T, A/B/C, L1/L2/L3, or U/V/W
convention	

Other functionality		
Verification and warning function	Over-range, peak-over, event indicator	
Setting verification function	Allows the user to check the current settings by pressing the [QUICK SET] key during recording.	
Screenshot	Saves the contents of the screen when the COPY key is pressed to the SD memory card. Data format: Compressed BMP	
Key lock	Disables all key operation except the POWER key.	
SD memory card eject	Pressing the F key on the FILE screen during recording with a recording interval of 2 s or greater displays a confirmation and allows the SD memory card to be ejected.	
System reset	Reverts the instrument's settings to their default values.	
Automatic detection of current sensors	When selected on the settings screen, automatically detects connected Hioki PL14 connector-compatible sensors.	
Behavior in event of power outage	If a Z1003 Battery Pack with remaining power is installed in the instrument, the instrument automatically switches to battery power and continues recording. If not, measurement operation	

SD memory card		
Compatible cards: Z4001, Z	4003	
LAN Interface		
Connector: Electrical specifications: Transmission method: Protocol: Functionality:	RJ-45 connector × 1 IEEE 802.3 compliant 100Base-TX TCP/IP (with DHCP function) Allows remote operation of the instrument from an Internet browser.	
USB interface		
	receptacle x 1 (Full Speed, High Speed), mass storage class	
RS-232C interface		
Connector: Communication method:	D-sub 9-pin connector x 1 RS-232C, EIA RS-232D, CCITT V.24, and JIS X5101 compliant Full duplex, start stop synchronization, data length of 8, no parity, 1 stop bit	
Communications speed: Functionality:	19,200 bps / 38,400 bps Allows measurement and measurement data retrieval using communications commands.	

External control interface

Connector: 4-pin screwless terminal block

External event input: [IN], [GND1] External event output: [OUT], [GND2]

Event input: Shorts between the [GND1] and [IN] terminals (active-low) and the falling

edge of pulse signals are recognized as event input. Not isolated ([GND1] is common with the instrument's GND.) Maximum rated terminal-to-terminal voltage: 45 V DC Voltage input (high: 2 V to 45 V; low: 0 V to 0.5 V) High interval: At least 100 ms; low interval: at least 100 ms

Event output: Open collector, 30 V/ 5 mA max. (photocoupler-isolated)

TTL low output at event generation between [GND2] and [OUT] terminals Short pulse: Starts/stops measurement at width of approx. 10 ms; outputs pulse at event IN point.

Long pulse: Outputs pulse at event IN point only at width of approx. 2.5 s.

	1 2 1			
General Specifications				
Operating environment	Indoors, altitude up to 3000 m Pollution degree 2			
Operating temperature and humidity	-20 to 50°C (-4 to 122°F), 80% RH or less (non-condensating)			
Storage temperature and humidity	-20 to 50°C (-22 to 122°F), 80% RH or less (non-condensating)			
Dust and water resistance	IP30 (EN 60529)			
Applicable standards	Safety: EN 61010 EMC: EN 61326 Class A			
Standard compliance	Harmonics: IEC 61000-4-7			
Power supply	[Z1002 AC Adapter] 100 V to 240 V AC, 50 Hz/60 Hz Anticipated transient overvoltage: 2500 V Maximum rated power: 80 VA (including AC adapter) [Z1003 Battery Pack] Charging time: Max. 5 h 30 m Continuous operating time: Approx. 8 h			
Maximum recording interval	1 year			
Maximum number of recordable events	9999			
Clock functionality	Auto calendar, automatic leap year detection, 24-hour clock			
Real-time clock accuracy	±0.5 s per day (with instrument on and within operating temperature range)			
Display	6.5-inch TFT color LCD Display refresh: 0.5 s			
Dimensions	300 mm (11.81 in) W \times 211 mm (8.31 in) H \times 68 mm (2.68 in) D (excluding protrusions)			
mass	2.5 kg (88.2 oz) (including battery pack)			
Product warranty period	3 year			
Accessories	Instruction manual, Measurement guide, VOLTAGE CORD L1000-05, spiral tubes, AC ADAPTER Z1002, strap, USB cable, BATTERY PACK Z1003, PQ ONE (software, CD)			

Current measurement options

-						
Model	AC CURRENT SENSOR CT7126		AC CURRENT SENSOR CT7131		AC CURRENT SENSOR CT7136	
Appearance	11				9/	
Rated measurement current	60 A AC			100 A AC	600 A AC	
Measurable conductor diameter	Max.φ15 mm (0.59 in)		Мах.ф46 mm (1.81 in)			
PQ3100 current range and combined amplitude accuracy (45 to 66 Hz)	Current range 50.000 A 5.0000 A 500.0 mA	· ·	Current range 100.00 A 50.00 A 5.000 A	Combined accuracy 0.4% rdg. + 0.12% f.s. 0.4% rdg. + 0.14% f.s. 0.4% rdg. + 0.50% f.s.	Current range 500.00 A 50.00 A 500.0 mA	Combined accuracy 0.4% rdg. + 0.112% f.s. 0.4% rdg. + 0.22% f.s. 0.4% rdg. + 1.3% f.s.
Phase accuracy (45 to 66 Hz)	±2° or less		±1° or less		±0.5° or less	
Maximum allowable input (45 to 66 Hz)	60 A continuous		130 A continuous		600 A continuous	
Maximum rated voltage to earth	CAT III 300 V		CAT III	1000 V, CAT IV 600 V		
Frequency band	Accuracy defined to 20 kHz					
Dimensions, mass, cord length	46 mm (1.81 in) W × 135 mm (5.31 in) H × 21 mm (0.83 in) D, 190 g (6.7 oz), 2.5 m (8.2 ft) 78 mm (3.07 in) W × 152 mm (5.98 in) H mm (1.65 in) D, 350 g (12.3 oz), 2.5 m (8.2 ft)					
Output connector	Hioki PL14					

Model	AC FLEXIBLE CURRENT SENSOR CT7044	AC FLEXIBLE CURRENT SENSOR CT7045	AC FLEXIBLE CURRENT SENSOR CT7045
Appearance			
Rated measurement current	6000 A AC		
Measurable conductor diameter	Max.φ100 mm (3.94 in)	Мах.ф180 mm (7.09 in)	Max.φ254 mm (10.00 in)
PQ3100 current range and combined	Current range Combined accuracy		
amplitude accuracy	5000.0 A/ 500.00 A 1.6% rdg. + 0.4% f.s.		
(45 to 66 Hz)	50.000 A 1.6% rdg. + 3.1% f.s.		
Phase accuracy (45 to 66 Hz)	±1.0° or less		
Maximum allowable input (45 to 66 Hz)	10,000 A continuous		
Maximum rated voltage to earth	1000 V AC (CAT III), 600 V AC (CAT IV)		
Frequency band	10 Hz to 50 kHz (±3dB)		
Dimensions, cord length	Flexible loop cross-sectional diameter \$\phi7.4\$ mm (0.29 in)/ 2.5m (8.2 ft)		
Mass	160 g (5.6 oz)	180 g (6.3 oz)	190 g (10.00 oz)
Output connector	HIOKI PL14		

Model	AC/DC AUTO-ZERO CURRENT SENSOR CT7731	AC/DC AUTO-ZERO CURRENT SENSOR CT7736	AC/DC AUTO-ZERO CURRENT SENSOR CT77742	
Appearance	Q /	\$ \	A /	
Rated measurement current	100 A AC/DC	600 A AC/DC	2000 A AC/DC	
Measurable conductor diameter	Мах. ф 33 п	nm (1.30 in)	Мах.ф55 mm (2.17 in)	
PQ3100 current range and combined amplitude accuracy 45 to 66 Hz	Current range Combined accuracy 100.00 A 1.5% rdg. + 1.0% f.s. 10.000 A 1.5% rdg. + 5.5% f.s. 100.00 A 1.1% rdg. + 0.6% f.s. 10.000 A 1.1% rdg. + 5.1% f.s.	Current range Combined accuracy 500.00 A 2.5% rdg. + 1.1% f.s. 50.000 A 2.5% rdg. + 6.5% f.s. 500.00 A 2.1% rdg. + 0.7% f.s. 50.000 A 2.1% rdg. + 6.1% f.s.	Current range Combined accuracy 2000.0 A 2.0% rdg. + 1.75% f.s. 1000.0 A 2.0% rdg. + 1.5% f.s. 500.00 A 2.0% rdg. + 2.5% f.s. 2000.0 A 1.6% rdg. + 0.75% f.s. 1000.0 A 1.6% rdg. + 1.1% f.s. 500.00 A 1.6% rdg. + 2.1% f.s.	
Phase accuracy (45 to 66 Hz)	±1.8° or less		±2.3° or less	
Offset drift	±0.5% f.s. or less	±0.1% f.s. or less	±0.1% f.s. or less	
Maximum allowable input (45 to 66 Hz)	100 A continuous	600 A continuous 2000 A continuous		
Maximum rated voltage to earth	600 V AC/DC (CAT IV)	1000 V AC/DC (CAT III), 600 V AC/DC (CAT IV)		
Frequency band	DC to 5 kHz (-3dB)			
Dimensions, mass, cord length	58 mm (2.28 in) W × 132 mm (5.20 in) H × 18 64 mm (2.52 in) W × 160 mm (6.30 in) H × 34 64 mm (2.52 in) W × 195 mm (7.68 in) H mm (0.71 in) D, 250 g (8.8 oz), 2.5 m (8.2 ft) mm (1.34 in) D, 320 g (11.3 oz), 2.5 m (8.2 ft) mm (1.34 in) D, 510 g (18.0 oz), 2.5 m (8.2 ft)			
Output connector	HIOKI PL14			

Model	AC LEAKAGE CURRENT SENSOR CT7116		
Appearance	Exclusively for leakage current measurement condu		
Rated measurement current	6 A AC		
Measurable conductor diameter	Max.φ40 mm (1.57 in)		
PQ3100 current range and combined amplitude accuracy (45 to 66 Hz)	Current range Combined accuracy 5.0000 A 1.1% rdg. + 0.16% f.s. 500.00 mA 1.1% rdg. + 0.7% f.s. 50.000 mA 1.1% rdg. + 6.1% f.s.		
Phase accuracy (45 to 66 Hz)	±3 ° or less		
Frequency band	40 Hz to 5 kHz (±3.0% rdg. ±0.1% f.s.)		
Residual current characteristics	Max. 5 mA (in 100A go and return electric wire)		
Effect of external magnetic fields	400A AC/m corresponds to 5mA, Max. 7.5mA		



Used to connect the following current sensors to the PQ3100. (Output connector conversion: BNC to PL14)

CLAMP ON SENSOR 9694, 9660, 9661, 9669

AC FLEXIBLE CURRENT SENSOR CT9667-01, CT9667-02, CT9667-03 (Power cannot be supplied to these sensors from the PQ3100.)

Find Quality Products Online at:

www. GlobalTestSupply. com

PQ3100 Lineup

POWER QUALITY ANALYZER KIT Value Kits POWER QUALITY ANALYZER KIT POWER QUALITY ANALYZER KIT POWER QUALITY ANALYZER KIT Model Name Model No. (Order Code) PQ3100-91 PQ3100-92 PQ3100-94 POWER QUALITY ANALYZER PQ3100*: 1 POWER QUALITY ANALYZER PQ3100*: 1 POWER QUALITY ANALYZER PQ3100*: 1 AC CURRENT SENSOR CT7136: 2 AC CURRENT SENSOR CT7136 : 4 AC FLEXIBLE CURRENT SENSOR CT7045: 4 Kit contents CARRYING CASE C1009: 1 CARRYING CASE C1009: 1 CARRYING CASE C1009: 1 SD MEMORY CARD 2GB Z4001: 1 SD MEMORY CARD 2GB Z4001: 1 SD MEMORY CARD 2GB Z4001: 1

^{*} PQ3100 accessories : Instruction manual, Measurement guide, VOLTAGE CORD L1000-05, Spiral Tube, AC ADAPTER Z1002, Strap, USB cable, BATTERY PACK Z1003, PQ ONE (Software, CD)

Current measurement options	
AC CURRENT SENSOR CT7126	60 A AC, φ 15 mm (0.59")
AC CURRENT SENSOR CT7131	100 A AC, φ15 mm (0.59")
AC CURRENT SENSOR CT7136	600 A AC, φ46 mm (1.81")
AC FLEXIBLE CURRENT SENSOR CT7044	6000 A AC, φ100 mm (3.94")
AC FLEXIBLE CURRENT SENSOR CT7045	6000 A AC, φ180 mm (7.09")
AC FLEXIBLE CURRENT SENSOR CT7046	6000 A AC, φ254 mm (10.0")
AC LEAKAGE CURRENT SENSOR CT7116	6 A AC, φ40 mm (1.57")
AC/DC AUTO-ZERO CURRENT SENSOR CT7731	100 A AC, φ33 mm (1.30")
AC/DC AUTO-ZERO CURRENT SENSOR CT7736	600 A AC, φ33 mm (1.30")
AC/DC AUTO-ZERO CURRENT SENSOR CT7742	2000 A AC, φ55 mm (2.17")
CONVERSION CABLE L9910 (BNC to PL14)	For BNC connector conversion

^{*}The connectors used on CT7000 series current sensors differ from those used on legacy products. To use a legacy sensors, use Conversion Cable L9910.

Voltage measurement options





MAGNETIC ADAPTER 9804-01 (red) MAGNETIC ADAPTER 9804-02 (black)

Magnetic tip for use with the standard Voltage Cord L1000-05 (generally compatible with M6 pan screws)

Red and black adapters sold separately. Purchase the quantity and color appropriate for your application. (Example: 3P3W - 3 adapters; 3P4W - 4 adapters)



Hioki welcomes requests for quotations for customized specifications such as current sensor cord extensions, voltage cord extensions, and voltage cord tip changes. For more information, please contact your nearest Hioki distributor

Carrying cases, Water proof boxes



CARRYING CASE C1009 Bag



CARRYING CASE C1002 413W× 595W× 265Dmm (16.3"W× 23.4"H× 10.4"D) 5.7kg (201oz.)



C1001 Soft case



Waterproof box For outdoor installation: IP65 compliant Contact Hioki for a quotation

Interfaces



SD MEMORY CARD 2GB



SD MEMORY CARD 8GB Z4003

IMPORTANT

Use only the SD memory card Z4001 or Z4003 sold by HIOKI.



RS-232C CABLE Length: 1.8 m (5.91 ft) Cross, 9pin to 9pin



9642

LAN CABLE

Length: 5 m (16.41 ft) supplied with straight to cross conversion cable

Model: POWER QUALITY ANALYZER PQ3100



Model No. (Order Code): PQ3100 For more information about accessories, see the specifications table above.

Bundled accessories



Voltage Cord L1000-05 5 cords (1 ea. black, red, yellow, green, and gray) Length: 3 m (9.84 ft)



AC ADAPTER Z1002 Power supply for the PQ3100 100V AC to 240V AC



BATTERY PACK Z1003 (Ni-MH, 7.2 V/4500 mAh)